

Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333









Tuesday, August 17, 2010
Inspector
Tony Marino
727-433-2613
tony@npimarino.com

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 1 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

INVOICE #: TEMPLATE

Inspection Date: 8/17/2010 01:30 PM

NPI of Southern Pinellas County dba National Property Inspections

Clearwater FL

Client Name: Ronald Bullard

Property Location: 1234 Sunsoaked Dr.

St. Petersburg FL 33333

Billing Address: Unknown

Client Phone: (727)555-5555

Client Email:

TYPE OF INSPECTIONS PERFORMED

Home Inspection		\$275.00
	Subtotal	\$275.00
	Total	\$275.00
Grand Total	PAID	\$275.00

Buyer Agent Information

Agency: ReMax Agent: Jill Sellsalott

Cell #: (727) 666-6666

FL

Listing Agent Information

Agency: C-21 Agent: Harry House

Cell #: (727) 777-7777

 \mathbf{FL}

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 2 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

Special Note: All conditions and findings might not have been revealed or documented within this inspection process. It is recommended that any findings not documented or revealed be repaired or further evaluated by a licensed contractor that is specifically trained for the section or component that is in need of repair or evaluation prior to close of escrow.

"National Property Inspections expresses no opinion about the subject property beyond what is set forth in its home inspection report. The client may wish to obtain other types of inspections, such as environmental related inspections, regarding mold, indoor-air quality or other environmental issues, or the identification or testing of "Chinese Drywall", all of which are beyond the scope of this inspection and are not addressed in this Home Inspection report."

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 3 of 44



Inspection Date:

8/17/2010

Inspector: Tony Marino

Inspector Phone: (727) 433-2613

NPI of Southern Pinellas County dba National Property Inspections

Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

GENERAL INFORMATION

GEN	ERAL INFO	JKN	VIAII	UN						
GEN	ERAL COND	ITI	ONS A	AT TIM	E OF I	NSPECTION	:			
Property	Occupied:	No				Property Faces :	□ North	□ South	☑ East	□ West
Estimate	ed Age Of Property:	42	Y	rear(s)		Weather:	Sunny	Т	emperatu	re: 95 F
Type of l	Property :	☑ Si	ingle [□ Multi		Soil Conditions:	☑ Dry	□ Damp/ Wet	□ Snow	☐ Frozen
Primarv	Construction:	□ W	Vood 5	☑ Block	☐ Brick	Persons Present :	☑ Buyer		□ Seller	
							□ Buyer	's Agent	□ Seller	's Agent
☑ Othe	r: Stucco					☑ Other Present:	Inspecto	r/WDO inspe	ector	
	NITIONS : re listed the definiti	ons us	sed throu	ghout the r	eport to d	lescribe each feature	e of the pr	operty.		
ACC	(ACCEPTABLE)		The item	n/system was	performing	g its intended function a	at the time	of the inspect	tion.	
MAR	(MARGINAL)		The item inspection replacem	on. However	marginally , due to age	acceptable. (It perfore and/or deterioration,	rmed its des it will likely	rigned function V require ear	on at the tir ly repair or	ne of the
NI	(NOT INSPECTE	ED)	The item	· · · · · · · · · · · · · · · · · · ·	not inspect	ed due to safety concer	ns, inacces	sibility and/o	or concealm	nent or
NP	(NOT PRESENT))	The item	/system does	s not exist o	or was visually conceal	ed at the tin	ne of the insp	ection.	
DEF	(DEFECTIVE)			-		e/perform its intended the inspection.	function, w	as structurall	y deficient	, was unsafe
SCOI	PE OF THE I	NSP	PECTI	ON:						
such as,		servi	cing of fu	rnaces, air	condition	perty requires a cert ers, water heaters, e				
	owing report is based v. The following item				the accessi	ble areas of this prop	erty. Pleas	se read and	study the 6	entire report
Proper	ty was occupied	at tin	ne of ins	pection.						
Heated	square footage i	is app	oroximat	tely 1300.						
Client	opted to have a li	mited	d infrare	d thermal	scan pe	rformed.				

©1996-2010 Page 4 of 44

" Independently Owned and Operated "

Email: tony@npimarino.com



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 5 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333 **GRADING / DRAINAGE ☑** Monitor Condition ACC MAR NP DEF ☑ Recommend Repairs П $\overline{\mathbf{v}}$ Positive Slope Negative Slope **Ponding** Near Level Comments: Shallow hole and animal hole at south wall. Recommend back filling. Near level grading present around some areas of dwelling. Recommend monitoring during rainfall/moist conditions for possible ponding near the perimeter of the home for possible water intrusion problems that may effect the foundation system of the home and/or water intrusion problems. **DRIVEWAY Monitor Condition** ACC MAR NI NP DEF ☐ Recommend Repairs $\overline{\mathbf{V}}$ Concrete ☐ Asphalt Brick ☐ Gravel \square □ Cracks □ Settlement General Deterioration

Comments: Concrete driveway is in good condition. No cracking noted.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333



WALKS / STEPS				Monitor Condition		ACC	MAR	NI	NP	DEF
				Recommend Repair	s	\square				
 ✓ Concrete □ Flagstone □ General Deterioration □ Poor Earth / Wood Clearance 	□ Brick □ □ Handrail Loose / Mi		Pavers cks / Set	itlement		Tripp	ing Haz	ard	•	
Comments: Brick walks are	in good condition.									
PORCHES / STOOPS				Monitor Condition		ACC	MAR	NI	NP	DEF
				Recommend Repairs	3	\square				
□ Enclosed	☑ Open					_				
☐ General Deterioration	□ Settlement	□ Poc	r Earth	Wood Clearance		Handı	rail Loo	se/M	issin	ıg
Inspection Date: Inspector: 7		ed. ently Owned a		rated " : tony@npimarino.com	ı					

©1996-2010 Page 7 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333



DI	ECKS / BALCONY		☐ Monitor Condition		ACC	MAR	NI	NP	DEF
			☐ Recommend Repair	·s	\square				
V	Wood								
	General Deterioration	Defective Posts / Boards	No Footings Evident		Poor I	Earth / V	Wood	l Clea	rance
	Needs Joist Hangers	Not Bolted To House	Railing / Handrail Loose		Rail C	pening	Unsa	ıfe	

Comments: Deck is in good condition. Freshly painted. Posts have cement footers present. Rails are secured.



" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 8 of 44



	Ronald Bu	llard, 1234 S	Sunsoake	d Dr., St. Pete	rsburg, F	L, :	33333				
FENCES / GAT	ES			✓ Monitor	Condition		ACC	MAR	NI	NP	DEF
				□ Recomm	end Repairs			Ø			
☑ Wood		Plastic / PVC		Chain Link			Masonr	y			
☐ Wrought Iron											
☑ General Deteriorate	tion \square	Leaning		Rotting			Portion	(s) Miss	sing		
□ Needs Repairs											

Comments: Wood fence is in generally good condition but will need treating/painting to prolong the life of the wood in many areas.







" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 9 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

					1) 11 11 11 1 9)	, -					
M	AIN ROOF				☐ Monitor Condition		ACC	MAR	NI	NP	DEF
					□ Recommend Repai	rs	☑				
Ago	e: 2 Years	Des	sign Life: 15-18	Year(s)	Layers: 1		10	00 % Vi	sible		
	Visual From Ground		Walked On		Ladder at Eaves		Snow	Covere	d		
$\overline{\mathbf{V}}$	Asphalt/Composition		Wood Shake		Wood Shingle		Tile				
	Tar and Gravel		Metal		Rolled Composition		Slate				
	Membrane										
	Suspected Leak(s)		Missing Shingle(s)		Cupping/Curling/Lifting/Brittle		Previo	us Rep	airs N	loted	
	Excessive Granular Loss		Bubbling		Trim Trees / Branches		Impro	per Inst	allati	on	

Comments: Leaks not always detectable.

 $Roof is \ dimensional \ asphalt \ or \ asphalt/fiberglass \ shingles.$

Life expectancy of dimensional asphalt shingles is 15-18 years in this climate. Roof disclosed at 2 years of age.

Roof shows no defects. Starting to show signs of aging.

Roofing materials properly secured.

No broken or missing shingles noted.

All roof penetrations are in good condition and properly sealed.





" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 10 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333





FI	LAT ROOF				☐ Monitor Condition		ACC	MAR	NI	NP	DEF
					Recommend Repair	rs	V				
Ag	e: 2-4 Years	Des	sign Life : 8-10	Year(s)	Layers: 1		1	00 % Vi	sible		
	Visual From Ground	V	Walked On		Ladder at Eaves		Snow	Covere	d		
	Asphalt/Composition		Wood Shake		Wood Shingle		Tile				
	Tar and Gravel		Metal	$\overline{\checkmark}$	Rolled Composition		Slate				
	Membrane										
	Suspected Leak(s)		Missing Shingle(s)		Cupping/Curling/Lifting/Brittle		Previo	ous Rep	airs N	loted	
	Excessive Granular Loss		Bubbling		Trim Trees / Branches		Impro	per Inst	allati	on	

Comments: Leaks not always detectable.

Flat roof at rear is granuled asphalt roofing material. Roof shows no defects and does not appear to be holding water after rains.

Roof needs cleaning; tree debris present.

Small flat roof at south side in good condition. Shows slightly more wear than rear flat roof.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 11 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333



□ Gene	eral Deterioration osed Nails	 	Composition / Membrane Rust Previous Repairs Noted nd perimeter of eave		Improper Ir		Suspe	cted Le	□ ak(s)		
□ Gene	eral Deterioration osed Nails		Rust Previous Repairs Noted				Suspe	cted Le	ak(s)		
□ Expo	osed Nails		Previous Repairs Noted				Suspe	cted Le	ak(s)		
					Filled with	Debris					
Comment	ts: Metal flashing	arou	nd perimeter of eave								
					_	-					
GUTT	ERS/DOWN SPC	OUTS	8			Monitor Condition	ACC	MAR	NI	NP	DEF
						Recommend Repairs					
□ Alun	ninum		Copper		Steel	□ Vinyl					
□ Miss	sing		Rust / Corroded		Leaking	□ Loose					
□ Fille	d with Debris		Misaligned		Missing Ex	tension / Splash Block					
Comment	ts: Recommend a	ddino	g gutters to the home	e to	keep wate	r away from foundat	ion.				
		•			•	•					

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 12 of 44



Ronald Bul	lard, 1234 Sunsoal	ked	l Dr., St. Peters	burg	g, FL, 3	3333				
EXTERIOR SURFACE			☑ Monit	or Co	ndition	☑ Rec	ommer	d Re	pairs	1
						ACC	MAR	NI	NP	DEF
SIDING/TRIM							Ø			
EXTERIOR FAUCETS						Ø				
EXTERIOR ELECTRICAL OUTLETS	□ NO GFCI								Ø	
EXTERIOR LIGHTING						Ø				
☑ Wood □	Metal		Vinyl		Stucco					
☐ Synthetic Stucco ☐	Composite		Veneer		Brick					
☐ General Deterioration ☐	Needs Paint		Missing/Loose	\checkmark	Cracked					
✓ Needs Caulk / Seal □	Poor Earth / Siding Cleara	nce								
	offit boards are in good d repainted. Monitor			ıred,	little de	cay no	oted, v	whic	h	
Exterior lights oper	ational (show power)	and	d faucets are oper	ation	al.					
_	ucco siding over cen generally good condi									

" Independently Owned and Operated "

Inspection Date : Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613


©1996-2010 Page 13 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333





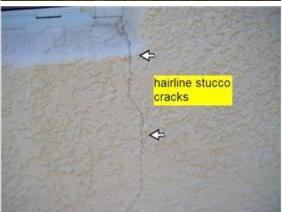

WINDOWS		☐ Monitor Condition	ACC	MAR	NI	NP	DEF
		☐ Recommend Repairs	Ø				
□ Wood ☑	Vinyl	Metal					
☑ Insulated Panes □	Single Pane	Window Wells					
☐ General Deterioration ☐	Needs Caulk / Seal	Defective / Damaged Storm Windows					
□ Needs Paint / Finish □	Fogged	Painted Shut					

Comments: All windows operational with working locks.

No broken or cracked windows present at time of inspection.

FYI-No screens present except at kitchen.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 14 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333



EX	KTERI	OR DOORS				□ N	Monitor Conditio	n	ACC	MAR	NI	NP	DEF
							Recommend Repa	airs					
\checkmark	Wood	✓ Metal		Vinyl Fit	perglas	s 🗹 G	Salvanized						
	General	Deterioration		Delaminated / Damaged		Missing / Dan	naged Hardware		Doorbel	l Inoper	ative		
	Screen /	Storm Door Damaged		Evidence of Leak(s)		Repair/Replac	ce Weather-Strip		leeds C	aulk / S	eal		
Cor	nments :	Inspected all ext	erio	or doors and all were	e ope	rational at t	time of inspec	ction.	Reco	mmer	nd re) -	

keying locks for safety.

Exterior door[s] have sections of glass. Not a defect, however recommend changing deadbolt lock to "keyed-both-sides" type lock for safety.



" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

Inspector Phone: (727) 433-2613 8/17/2010

Page 15 of 44 ©1996-2010



	Ronald	Bull	ard, 1234 Sunso	aked	Dr., St.	Petersburg, FL,	33333				
FC	OUNDATION					Monitor Condition	ACC	MAR	NI	NP	DEF
						Recommend Repairs		Ø			
	Concrete Block	$\overline{\checkmark}$	Concrete		Slab		Post / Pie	er			
	Brick		Stone		Wood		Sub-Gra	de Entr	yway		
	General Deterioration		Horizontal Cracks		Step Cracks		Vertical	Cracks			
✓	Limited Observation		Needs Caulk / Seal		Trim Vegeta	ation					
Coı	mments: Very limited vis	ibilit	y due to design or l	lands	caping. W	hat was viewed sh	owed n	o cra	cking	g.	
Coi	nments: Very limited vis	ibilit	y due to design or ∣	lands	caping. W	hat was viewed sh	owed n	o cra	cking	g.	
	nments: Very limited vis	ibilit	y due to design or l	lands	caping. W	hat was viewed she					rs
	,	ibilit		lands	caping. W						rs
G A	ARAGE/CARPORT		l Carport	lands	caping. W				end I		irs DEF
GÆ ☑ ☑	ARAGE/CARPORT Attached		Carport Three or More Cars	lands	caping. W		n 🗆 R	ecomm	end I	Repai	
GÆ ☑ ☑	ARAGE/CARPORT Attached		Carport Three or More Cars	lands	caping. W		n □ R	ecomm MAR	end I	Repai	DEF
GA ☑ ☑ FLO	ARAGE/CARPORT Attached		Carport Three or More Cars	lands	caping. W		n 🗆 Ro	ecomm MAR ☑	end I	Repai	DEF

Comments: Garage is in generally good condition for its age. No defects noted. Electrical is in good order.

Seal hole where ac condensation line exits south wall.





" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

 \square Outlets NOT GFCI Protected \square Electrical Deficiencies

©1996-2010 Page 16 of 44



OVERHEAD GARAGE DOORS Monitor Condition Recommend Repairs ACC MAR NI NI NI NI NI NI NI N	OVEDU	EAD CADACE		,	ikeu	Dr., St. Petersburg, FL, 3	ACC		NI	NP	DEI
☐ General Deterioration ☐ Loose Track ☐ Repair / Replace Weather-Stripping ☐ Missing / Damaged Hardware ☐ Damaged / Inoperative ☐ Repair / Adjust Automatic Reverse Comments: There is not a garage door opener present. The door operated properly when maneuvered manually.	OVEKH	IEAD GARAGE	DO	OKS				_			
☐ Missing / Damaged Hardware ☐ Damaged / Inoperative ☐ Repair / Adjust Automatic Reverse Comments: There is not a garage door opener present. The door operated properly when maneuvered manually.	□ Wood		V	Metal		Fiberglass		•			
Comments: There is not a garage door opener present. The door operated properly when maneuvered manually.	☐ Genera	al Deterioration		Loose Track		Repair/Replace Weather-Stripping					
The door operated properly when maneuvered manually.	□ Missin	g / Damaged Hardware		Damaged / Inoperative		Repair / Adjust Automatic Reverse					
Overhead garage door has been damaged by car. Recommend further evaluation and	Comments	There is not a a				od manually					
repair/replacement by a qualified garage door technician.			ed	properly when mane	uvei	eu manuany.					



\overline{A}	ttic / Roof											
M	ethod of Inspection	on 🗹	Physical Entry	□ Visua	l from Access	□ No Access / L	imite	d Vie	w	90	% V	isible
A	TTIC / ROOF FRAMII		/SHEATHIN	G	□ Мо	nitor Condition	Α	СС	MAR	NI	NP	DEF
				□ Rec	commend Repairs		Ø					
$\overline{\checkmark}$	Trusses		Rafters		Plywood / Par	nel Board / Boards						
				Water Stains /	Suspected Leak(s)		Del	aminat	ed			
Co	mments: Leaks not	always detectab	ole.									
	• •	•	of attic was vi									

Approximately 90% of attic was viewed.

No leaks detected at time of inspection.

Roof penetrations are in good condition with no leaks noted.

FYI-Roof sheathing is Dimensional lumber.

	" Indepe	ndently Owned and Operated "
Inspection Date : 8/17/2010	Inspector: Tony Marino Inspector Phone: (727) 433-2613	Email: tony@npimarino.com

©1996-2010 Page 17 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333







A 7	TTIC / ROOF VENTII	LA1	TION	☑ Monitor Con	ndition	ACC	MAR	NI	NP	DEF
				☑ Recommend	Repairs		Ø			
V	Gable	$\overline{\checkmark}$	Ridge	Soffit	□ Sta	atic Vent		Turb	ine	
	Powered Vent		Attic Fan	Whole House Fan	□ No	Venting				
	Additional Vents Needed		Obstructed Air Flow	Clothes Dryer / Exhaust F	ans Vente	ed Into Atti	ic			

Comments: There is a missing soffit vent screen at n/w corner of back wall. Probable animal intrusion. Recommend repairs as needed.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 18 of 44



Inspection Date:

8/17/2010

Inspector: Tony Marino

Inspector Phone: (727) 433-2613

NPI of Southern Pinellas County dba National Property Inspections

Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333



	ROOF INSULATION		Monitor Condition	1 A	CC	MAR	NI	NP	DEF
			Recommend Repa	irs	V				
☑ Loose F	l □ Blanket	☐ Missing		Uneven D	istri	ibution			
Comments:	Blown in cellulose insulation	in attic. Sufficient amou	ınt in visible are	as.					
ATTIC F	LECTRICAL		Monitor Condition	A		MAR	NI	NP	DEF
ATTIC F	LECTRICAL		Monitor Condition Recommend Repair	-	CC ☑	MAR	NI 🗆	NP	DEF
	LECTRICAL ices / Junction Boxes			-		_		_	_
□ Open Sp			Recommend Repair	-		_		_	_
□ Open Sp	ices / Junction Boxes	ee Electrical Section for additi	Recommend Repair	rs		_		_	_
				-		_		_	_
☐ Open Sp	ices / Junction Boxes		Recommend Repair	-		_		_	_
	ices / Junction Boxes Limited visibility due to obstructions. S	ee Electrical Section for additi	Recommend Repair	rs		_		_	_

©1996-2010 Page 19 of 44

" Independently Owned and Operated "

Email: tony@npimarino.com



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

ELECTRICAL				☑ Monitor Co	ndition	☑ Rec	comme	nd R	epair	·s
SERVICE SIZE (Main Panel) □ 110 Volt (Nominal) □ 125 Amp		110 / 220 Volt (Nominal) 150 Amp		120 / 240 Volt (Nominal) □ 200 Amp □	60 Am				Amp	
SERVICE SIZE (Sub Panel) □ 40 Amp		60 Amp		100 Amp □	Undet	ermined	d			
SERVICE	V	Overhead Undergro	ound			ACC	MAR	NI	NP	DEF
ENTRANCE CABLE		Aluminum				V				
PANEL	$\overline{\checkmark}$	Breaker(s)		☐ Combination ☑ Garage						V
SUB-PANEL		Breaker(s)		☐ Combination					Ø	
BRANCH CIRCUITS	$\overline{\checkmark}$	Solid Aluminum 🗹 Copper		☑ Braided aluminum			Ø			
BONDING/GROUNDING						V				
GFCI(IN PANEL)*									Ø	
ARC FAULT									Ø	
SMOKE DETECTORS*										
☐ Overfused		Double Tapping		Rust / Corrosion		Insuf	ficient	Acces	SS	
☐ Looses Connections		No Main Disconnect		Fuse / Breakers Incorrectly Size	ed 🗆	Overl	heating	/ Sco	rchin	g
☐ Improper Splices		Open Knockouts		Water Meter Not Jumpered		Impro	oper Gr	ound		
		CI's checked with test button		. Monthly Test Recommended.						

No panel cover present; safety hazard. Recommend replacing as soon as possible. Exposed romex wiring from circuit panel should be enclosed in conduit. The disconnect panel at the AC unit is a federal Pacific brand panel, which has been deemed defective by the Consumer Product Safety Commission for internal breakers failing to trip under certain electrical load conditions resulting in electrical fires. Recommend further evaluation and replacement by a qualified electrician.

Branch circuits in the main panel are solid aluminum wiring which have a propensity to expand and contract with heat. 3 breakers on right side of panel. Solid Aluminum wiring is no longer used in homes. The wiring is not an issue as long as the connections in both the service panel and the outlets/fixtures are aluminum rated. Recommend further evaluation and repairs by a licensed electrician for all above concerns.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com


8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 20 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333



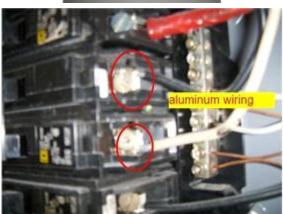





" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 21 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

	Ronald Bunard, 1254 Sunstaked Dr., St. Tetersburg, 111, 55555											
PLUMBING						□ Monitor Co	ndition 🗹	Reco	ommen	d Re	pairs	3
Water Service :	1 Water Pul	olic 🗆	Water Private		Water Off	Water Shut Of	Location :	North	wall			
Sewage Service : ☑	Sewage P	ublic 🗆	Sewage Private		Fuel Off							
								ACC	MAR	NI	NP	DEF
SUPPLY 5	☐ Copper ☐	Galvanized	☑ Plastic ☐ Polyb	utylene	☐ PEX							V
DRAINS 5	Ĭ PVC □	Cast Iron	☑ Copper ☐ ABS					☑				
EJECTOR PUMP											Ø	
VENTS [PVC 🗹	Cast Iron	☐ Copper ☐ ABS					V				
☐ General Deterio ☐ Missing / Impro			nproper Connections uspected Leak(s)		☐ Low Flow☐ Improper V	_	Water Co Water Ha			Part o	f Insp	p.

Comments: Main utility line, septic systems and gray water systems are excluded from this Inspection.

Main water shutoff located at the north wall. Valve handle missing. Recommend replacing in case of emergency.

Copper supply lines have been interupted at water heater with PVC piping. No bond wire present.

Recommend repairs by a licensed plumber.





" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 22 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

			Rona	iu Dui	iai u,	1234 8	unsua	ancu	D1., 5t.	1 CICI SD	urg, ri	1, 5.)333				
W	ATER F	ΙΕΑ	TER							Monitor C	Condition		ACC	MAR	NI	NP	DEF
										Recomme	nd Repair	'S		Ø			
Bra	and: GE					1	Model:	GE5	OM6A			Si	ze:	50	Gall	ons	
Α	age: 11		Years			Desig	n Life :	12-15	5 Years	Seria Seria	l No : 099	9B15	520				
	Gas	$\overline{\checkmark}$	Electric		Oil		Solar		Integral wit	h Boiler							
	Leaks				Rust / C	Corrosion			Improper E	levation	□ In	sulat	ion Bla	nket O	bstru	ets Vi	ew
	Gas Leak				Faulty	Flue Con	nection		At or Near 1	Design Life	□ B	eyono	d Desig	gn Life			
	Missing /	Impro	oper Pressu	re Relief	Valve / E	Extension			Seismically	Strapped							
<u> </u>																	

Comments: Water heater is located in the garage.

Water heater is operational at time of inspection.

Electric & gas water heater design lives are 12-15 years, depending on quality of water.

Some rust at base of unit. Monitor closely.





" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 23 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

LAUNDRY FACILITIES	S			☐ Monitor Condition ■	☑ Rec	ommei	nd Re	epair	s
Location: Garage					ACC	MAR	NI	NP	DEF
UTILITY HOOKUPS		Gas (Dryer)	☐ Electric (Dryer)		Ø				
DRYER VENTS									Ø
LAUNDRY TUB								Ø	
DRAIN									Ø

Comments: Electrical connections wired properly.

Laundry utilities are located in the garage.

No washer or dryer present. Tested drainline with a hose and the drainline leaked badly at the connection near wall. Rubber collar was used to connect pipes; improper. Recommend repairs by a licensed plumber.

Dryer vent missing cover/flap at exterior wall. Recommend replacement.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com


8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 24 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333



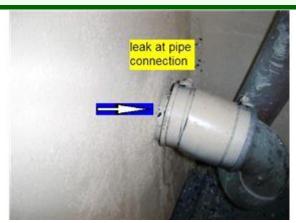



" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 25 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

H	EATING				☐ Monitor Condition		Rec	ommer	ıd Re	epairs	S
Br	and: Goodman]	Model: ARUF182416	BA	BTUs:						
1	Age: 1 Year(s)	Desig	gn Life: 15	Year(s)	Serial No: 1001688876		ACC	MAR	NI	NP	DEF
OP	ERATION						Ø				
ΑB	OVE GROUND STORAGE TA	NKS								Ø	
HU	MIDIFIER									Ø	
V	Forced Air		Heat Pump		Boiler / Hot Water		Stea	m			
	Baseboard / Radiant		Gravity								
	Gas		Electric		Oil		Prop	ane			
	Air Source		Water Source								
	Rusted Heat Exchanger		Unusual Flame Pattern	. 🗆	Too Warm to Test		Shut	Down	For S	Seaso	n
	Corroded / Leaking		At or Near Design Life	e 🗆	Beyond Design Life						
	Improper Temperature Rise		Needs Normal Mainter	nance / Cl	leaning						
	Missing / Improper Pressure F	Relief	Valve Leaks		Underground Storage Tank Not Part	of Iı	nspect	ion			
~		1.1	1 /1 1	vat 11	411						

Comments: Heat Exchanger - Unable to detect cracks/holes without dismantling unit.

Airhandler is located in the garage.

A "split-system" air conditioner is actually a single unit split into two sections, an air handler indoors and a condensing unit outdoors. These units act as one, so therefore, if one of the units is not maintained properly or is in disrepair, it may damage the other unit.

Life expectancy of Air Handlers is 15 years.

Unit was tested in HEAT mode; operational.

Interior of unit is clean.





" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 26 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

HEATING DISTRIBU	TION	Г			Monitor Condition	n 🗆	Reco	ommen	1d Re	pairs	S
						A	ACC	MAR	NI	NP	DEF
DISTRIBUTION							Ø				
BLOWER							Ø				
CONTROLS/THERMOSTAT	(CALIE	BRATIONS/TIMED) FUNCTION	S NOT CHECKI	ED.)		Ø				
CIRCULATOR PUMP										Ø	
✓ Ductwork		Radiators		Baseboard							
□ Rusted		Dirty Filter		Crushed/Disc	connected Ducts		Nois	sy Blov	ver		
☐ Air Leaks Noted at Plenum	/ Duct Jo	oints		Circulator Pun	np Leaking / Noisy /	Inoper	able				
Comments: All				·	·					-	

Comments: All newer ductwork in attic.

No defects noted to ductwork in attic.

Life expectancy of flexible insulated ductwork is 25 years.



" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 27 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333 AIR CONDITIONER ☑ Monitor Condition ACC MAR NI NP DEF ☐ Recommend Repairs П $\overline{\mathbf{v}}$ П Brand: Goodman Model: GSC130247AE Size: 2.5 tons Design Life: 10-15 Age: 2 Years Serial No:0807145646 **OPERATION** Electric □ Gas Central Wall ☐ Evaporative Cooler $\overline{\mathbf{V}}$ ☐ Outside Unit Not Level Dirty/Damaged Condenser □ Noisy Fan / Compressor Outside Temp Too Cold to Test ☐ No Pad Under Unit No Outside Disconnect Remove Obstructions / Vegetation □ Rust / Corrosion ☐ At or Near Design Life Beyond Design Life Missing/Improper Condensate Line Damaged Suction Line Window Units Not Inspected Suspected Leak(s) / Clogged Condensate Temperature Differential Not Within Industry Standards Needs Normal Maintenance / Cleaning

Comments: AC unit is located at north wall.

Life expectancy of AC condensing/compressor units is 10-15 years.

Cooling system inspection limitations: We check for normal temperature differential between input and output air, unusual operating noises, visible damage or defects, and a variety of other possible defects. This inspection is not technically exhaustive. A more thorough inspection, can be performed by a qualified HVAC service professional, and is recommended when any defects or malfunctions are suspected.

System is operating properly. Temperature splits are within industry standards.

Insulation on freon line is missing/damaged. Recommend replacing.





" Independently Owned and Operated "


Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 28 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

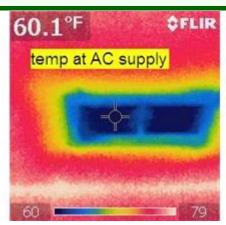



" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 29 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

KITCHEN				V	Monitor Condition	☑ Rec	ommei	ıd Re	pair	S
						ACC	MAR	NI	NP	DEF
CEILINGS		Typical Crack(s)	☐ Stain(s)			Ø				
WALL(S)		Typical Crack(s)	☐ Stain(s)			V				
WINDOWS/TRIM		Evidence of Leak(s)	☐ Inoperative		☐ Fogged	Ø				
WINDOW SCREENS		Missing	☐ Damaged			Ø				
FLOOR/FINISH						Ø				
INTERIOR DOORS/HARDWARE						Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTL	ETS, S	WITCHES, FI	XTURES.)			Ø				
GFCI PROTECTION (CHECKED WITH TEST B	UTTO	N ONLY. MO	NTHLY TEST	r RE	COMMENDED.)	\square				
HEAT/AIR DISTRIBUTION						\square				
COUNTERTOPS/CABINETS							Ø			
SINK/FAUCET						\square				
EXHAUST FAN									Ø	
STOVE TOP/OVEN		Gas	☑ Electric			\square				
STOVE ANTI-TIP BRACKET						\square				
WATER PRESSURE/FLOW/DRAINAGE						\square				
DISHWASHER/CROSS FLOW PROTECTION	Π ι	Leaking Seal	☐ Clogged Dra	ain			Ø			
REFRIGERATOR						\square				
MICROWAVE						V				
GARBAGE DISPOSAL		Seized	☐ Noisy		✓ Improper Elec. Connection	n 🗆				Ø

Comments: *No anomalies were detected when scanned with an infrared camera.

Garbage disposal wiring not in conduit.

Garbage disposal electrical stress clamp and conduit are missing. Recommend repairs by a qualified electrician.

Some cabinet doors are unlevel. Others, under sink, hit handles when opened.

Water line connected to refrigerator but ice maker was off and did not have enough time to produce ice during the inspection. Recommend testing at move-in.

Dishwasher is not secured to underside of countertop. Recommend repairs as needed.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 30 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333







" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 31 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

FAMILY ROOM			☐ Monitor Condition	☑ Re	comm	end F	Repai	rs
				ACC	MAR	NI	NP	DEF
CEILINGS	Typical Crack(s)	✓ Stain(s)						V
WALL(S)	Typical Crack(s)	Stain(s)		Ø				
WINDOWS/TRIM	Evidence of Leak(s)	☐ Inoperative	Fogged	Ø				
WINDOW SCREENS	Missing	☐ Damaged		Ø				
FLOOR/FINISH				Ø				
INTERIOR DOORS/HARDWARE				Ø				
ELECTRICAL (RANDOM				Ø				
CLOSET/STORAGE				Ø				
HEAT/AIR DISTRIBUTION				Ø				
BUILT IN SHELVING							Ø	
WET BAR	☐ No GFCI Protection						Ø	
MISCELLANEOUS							Ø	

Comments: Ceiling fan(s) are operational at time of inspection.

Stains noted on ceiling. Moisture detected when scanned with an infrared camera.

"Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 32 of 44


^{*}No anomalies were detected when scanned with an infrared camera.



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333





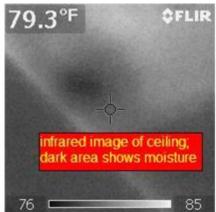

FIREPLACE			☑ Monitor Condition		ACC	MAR	NI	NP	DEF		
					☐ Recommend Repairs						
V	Wood Burning		Gas Log		Gas Starter		Fire	place I	nsert		
$\overline{\mathbf{V}}$	Masonry Firebox		Metal Firebox		Clean Out Trap						
	Damper Bent / Inoperable		Poor Drafting		Damaged Mortar / Firebrick						
	Damaged / Defective Doors		Missing Damper Stopper	\checkmark	Recommend Cleaning						
Car	mmanta: Pagammand annual al	oonin	Firenless design and soo	t / orc	pagata buildun in magt aggas provent	ci	ow of c	himno	, lina	r / orc	olea

Comments: Recommend annual cleaning - Fireplace design and soot / creosote buildup, in most cases, prevents view of chimney liner / cracks.

Fireplace appears in good condition with operational flue damper.

Have fireplace, flue and chimney cleaned before using by a qualified chimney contractor.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

Inspector Phone: (727) 433-2613 8/17/2010

Page 33 of 44 ©1996-2010



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333





" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 34 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

MAIN BATHROOM			☐ Monitor Condition	☑ Re	comm	end F	Repai	rs
				ACC	MAR	NI	NP	DEF
CEILINGS	☐ Typical Crack(s)	☐ Stain(s)		V				
WALL(S)	☐ Typical Crack(s)	☐ Stain(s)		V				
WINDOWS/TRIM	☐ Evidence of Leak(s)	☐ Inoperative	Fogged	V				
WINDOW SCREENS	Missing	☐ Damaged					V	
FLOOR/FINISH				V				
INTERIOR DOORS/HARDWARE				Ø				
ELECTRICAL (RANDOM SAMPLING	G OF OUTLETS, SWITCI	HES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WIT	TH TEST BUTTON ONLY	Y. MONTHLY TE	ST RECOMMENDED.)	V				
HEAT/AIR DISTRIBUTION				V				
COUNTERTOPS/CABINETS				V				
SINK/FAUCET	Leaking	☐ Cracked / Dama	aged	V				
TOILET	✓ Loose at Base	☐ Runs Continuou	ısly					Ø
TUB/SHOWER				V				
JETTED TUB	☐ No Service Access	☐ No GFCI					$ \overline{\checkmark} $	
TILE WORK/ENCLOSURE				V				
EXHAUST FAN				Ø				
WATER PRESSURE/FLOW/DRAINA	GE			Ø				

Comments:

No bathtub/shower access panel present. No moisture detected with moisture meter at the tilework.

Toilet is not properly secured to floor.

Recommend further evaluation and repairs by a licensed plumber.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 35 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333





☐ Monitor Condition ☐ Recommend Repairs **REAR BEDROOM** DEF ACC MAR NI NP **CEILINGS** \checkmark ☐ Typical Crack(s) ☐ Stain(s) WALLS ☐ Typical Crack(s) ☐ Stain(s) \checkmark WINDOWS/TRIM ☐ Evidence of Leak(s) ☐ Inoperative ☐ Fogged \checkmark WINDOW SCREENS Missing □ Damaged \checkmark FLOOR/FINISH \checkmark INTERIOR DOORS/HARDWARE \checkmark CLOSET \checkmark ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.) \checkmark HEAT/AIR DISTRIBUTION \checkmark

Comments: Also includes the attached room.

Ceiling fan(s) are operational at time of inspection.





" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 36 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

BEDROOMS 2&3				tor Condition	□ Re	comme	nd R	epaiı	·s
					ACC	MAR	NI	NP	DEF
CEILINGS	☐ Typical Crack(s)	☐ Stain(s)			Ø				
WALLS	☐ Typical Crack(s)	☐ Stain(s)			V				
WINDOWS/TRIM	☐ Evidence of Leak(s)	☐ Inoperative		Fogged	V				
WINDOW SCREENS	✓ Missing	☐ Damaged						Ø	
FLOOR/FINISH					V				
INTERIOR DOORS/HARDWARE					V				
CLOSET					V				
ELECTRICAL (RANDOM SAMPI	LING OF OUTLETS, SWITC	HES, FIXTURES.)				Ø			
HEAT/AIR DISTRIBUTION					V				

Comments:

Ceiling fan(s) are operational at time of inspection. Ceiling fan in front bedroom needs rebalancing. Noisy when running.







" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 37 of 44



T /	AWN SPRINKLER	iard, 1234 Sunsoai	200	□ Monitor Co	Θ,			MAR	NI	NΡ	DEF
	Zones: 6			□ Recommend Repairs							
V	Manual	Automatic		Shut Down for Season		Missing	/ Bro	oken He	ads		
	General Deterioration	Corrosion		Leaks (Above Ground)						ip	
	Missing Anti-Siphon Valve	Poor Water Pressure/Flow		Defective / Missing Cross	s Conn	ect Preve	entio	1			

Underground leaks may not be detected. Comments:

Rainbird control panel located in the garage.

System was operational in manual mode. No Broken or defective heads noted.





" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

Inspector Phone: (727) 433-2613 8/17/2010

Page 38 of 44 ©1996-2010



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

Rona	u Bunui	a, 120 i Sunst	Juix	a B 11, 50	• • •	300155 di 5, 1 E, 0					
SWIMMING POOL						Monitor Condition	Reco	ommen	d Re	pairs	
☐ In Ground	□ Abo	ve Ground		Winterized		Covered At Time Of Ir	spection	on			
☐ Concrete	□ Plas	ter / Shotcrete		Vinyl		Fiberglass					
							ACC	MAR	NI	NP	DEF
SHELL/LINER/HARDCOAT							Ø				
HEATER		☑ Gas		☐ Electric		Solar	Ø				
FILTER		✓ Cartridge		☐ Diatomaced	ous Ear	rth 🛘 Sand	Ø				
PUMP(S)		☐ Leak(s)		☐ Noisy		☐ Inoperative					
ELECTRICAL		☐ Missing/Loose Bo	ond	☐ Deteriorated	t		☑				
LIGHTS		☐ Inoperative		☐ Loose Hous	ing		☑				
GFCI (CHECKED W/TEST BU	JTTON ONI	Y). \square Inoperative		☐ Missing							
CHILD SAFETY FENCE		☐ Incorrect Height									
CHILD SAFETY GATE		☐ Not Self Latching	/Lock				☑				
DECK/APRON		☐ Settlement/Heavi	ing	☐ Cracking		☐ Common Crack(s)	☑				
☐ Poor Control Access	□ Broken	Missing Handrail		Defective / Mi	ssing	g Ladder □ Defe	ctive/N	lissing	Drair	ı Cov	er(s)
Comments: NOTE: Pool Bo	dies, Diving	Boards, Slides, Self-	-Clear	ning & Chlorir	nating	g Devices are beyond the	escope	of this:	inspe	ction	

TOTE: 1001 Bodies, Diving Bodies, Sildes, Self-Cleaning & Chroniating Devices are beyond the scope of this in

The pool surface and coping are in good condition; no defects noted. The pool and its components showed to be in good condition.



*Lawn Sprinklers, Pools, Hot Tubs, and Spas are all high maintenance items requiring ongoing care. This inspection is a visual only of exposed/accessible areas and is intended to comment on the overall condition of system(s) at the time of the inspection. It should not be construed as any type of insurance policy, warranty, or guarantee.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 39 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

Summary

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

EXTERIOR SURFACE

Siding/Trim

Body of house is stucco siding over cement block with wood fascia and soffit boards. Stucco siding is in generally good condition. Minor hairline cracking noted. Recommend sealing all cracks.

FOUNDATION

Very limited visibility due to design or landscaping. What was viewed showed no cracking.

GARAGE/CARPORT

Floor/Walls/Ceiling/Electrical

Seal hole where ac condensation line exits south wall.

OVERHEAD GARAGE DOORS

Overhead garage door has been damaged by car. Recommend further evaluation and repair/replacement by a qualified garage door technician.

GRADING / DRAINAGE

Shallow hole and animal hole at south wall. Recommend back filling.

Near level grading present around some areas of dwelling. Recommend monitoring during rainfall/moist conditions for possible ponding near the perimeter of the home for possible water intrusion problems that may effect the foundation system of the home and/or water intrusion problems.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 40 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

FENCES / GATES

Wood fence is in generally good condition but will need treating/painting to prolong the life of the wood in many areas.

ELECTRICAL

Panel

Branch Circuits

Main electrical service panel is located in the garage.

No panel cover present; safety hazard. Recommend replacing as soon as possible.

Exposed romex wiring from circuit panel should be enclosed in conduit.

The disconnect panel at the AC unit is a federal Pacific brand panel, which has been deemed defective by the Consumer Product Safety Commission for internal breakers failing to trip under certain electrical load conditions resulting in electrical fires. Recommend further evaluation and replacement by a qualified electrician.

Branch circuits in the main panel are solid aluminum wiring which have a propensity to expand and contract with heat. 3 breakers on right side of panel. Solid Aluminum wiring is no longer used in homes. The wiring is not an issue as long as the connections in both the service panel and the outlets/fixtures are aluminum rated.

Recommend further evaluation and repairs by a licensed electrician for all above concerns.

PLUMBING

Supply

Main water shutoff located at the north wall.

Valve handle missing. Recommend replacing in case of emergency.

Copper supply lines have been interupted at water heater with PVC piping. No bond wire present.

Recommend repairs by a licensed plumber.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 41 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

LAUNDRY FACILITIES

Dryer Vents Drain

Laundry utilities are located in the garage.

No washer or dryer present. Tested drainline with a hose and the drainline leaked badly at the connection near wall. Rubber collar was used to connect pipes; improper. Recommend repairs by a licensed plumber.

Dryer vent missing cover/flap at exterior wall. Recommend replacement.

KITCHEN

Garbage Disposal Countertops/Cabinets Dishwasher/Cross Flow Protection

Garbage disposal wiring not in conduit.

Garbage disposal electrical stress clamp and conduit are missing. Recommend repairs by a qualified electrician.

Some cabinet doors are unlevel. Others, under sink, hit handles when opened.

Water line connected to refrigerator but ice maker was off and did not have enough time to produce ice during the inspection. Recommend testing at move-in.

Dishwasher is not secured to underside of countertop. Recommend repairs as needed.

FAMILY ROOM

Ceilings

Stains noted on ceiling. Moisture detected when scanned with an infrared camera.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 42 of 44



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333
MAIN BATHROOM
Toilet Toilet is not properly secured to floor. Recommend further evaluation and repairs by a licensed plumber.
BEDROOMS 2&3
Electrical (Random sampling of outlets, switches, fixtures.)
Ceiling fan(s) are operational at time of inspection. Ceiling fan in front bedroom needs rebalancing. Noisy when running.
FIREPLACE
Fireplace appears in good condition with operational flue damper.
Have fireplace, flue and chimney cleaned before using by a qualified chimney contractor.
AIR CONDITIONER
Insulation on freon line is missing/damaged. Recommend replacing.
WATER HEATER
Some rust at base of unit. Monitor closely.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

Inspector Phone: (727) 433-2613 8/17/2010

Page 43 of 44 ©1996-2010



Ronald Bullard, 1234 Sunsoaked Dr., St. Petersburg, FL, 33333

VENTILATION

There is a missing soffit vent screen at n/w corner of back wall. Probable animal intrusion. Recommend repairs as needed.

FLOOR/SLAB

Limited/no visibility of concrete slab due to floor coverings. See individual rooms for floor covering issues.

MAR (MARGINAL)	The item/system was marginally acceptable. (It performed its designed function as of the time of the inspection. However, due to age and/or deterioration, it will likely require early repair or replacement.)
DEF (DEFECTIVE)	The item/system failed to operate/perform its intended function, was structurally deficient, was unsafe or was hazardous at the time of the inspection.

" Independently Owned and Operated "

Inspection Date: Inspector: Tony Marino Email: tony@npimarino.com

8/17/2010 Inspector Phone: (727) 433-2613

©1996-2010 Page 44 of 44