

Sample Report, 1452 Main, Anycity, , 45845



Monday, August 22, 2011 Inspector Joe Smith 548-254-3658

Inspection Date :

Inspector: Joe Smith



Sample Report, 1452 Main, Anycity, , 45845

GENERA	I INFO	DMA	TION

GENERAL CONDITIONS AT TIME OF INSPECTION: **Property Occupied:** No **Property Faces:** □ North □ South □ East **Estimated Age Of Property:** 16 Year(s) Weather: Fair Temperature: 45 F **Soil Conditions** : ☑ Dry □ Damp/ □ Snow □ Frozen ☑ Single □ Multi **Type of Property:** Wet **Persons Present** : □ Buyer □ Seller **Primary Construction:** □ Wood ☑ Block ☐ Brick ☐ Buyer's Agent ☐ Seller's Agent **DEFINITIONS:** Below are listed the definitions used throughout the report to describe each feature of the property. ACC (ACCEPTABLE) The item/system was performing its intended function at the time of the inspection. **MAR** (MARGINAL) The item/system was marginally acceptable. (It performed its designed function at the time of the inspection. However, due to age and/or deterioration, it will likely require early repair or replacement.) NI (NOT INSPECTED) The item/system was not inspected due to safety concerns, inaccessibility and/or concealment or seasonal conditions. The item/system does not exist or was visually concealed at the time of the inspection. NP (NOT PRESENT) DEF (DEFECTIVE) The item/system failed to operate/perform its intended function, was structurally deficient, was unsafe or was hazardous at the time of the inspection.

SCOPE OF THE INSPECTION:

National Property Inspections wishes to remind you, every property requires a certain amount of ongoing maintenance, such as, unclogging drains, servicing of furnaces, air conditioners, water heaters, etc. This property will be no exception. It is suggested that you budget for regular maintenance/repairs.

The following report is based on visual inspection only of the accessible areas of this property. Please read and study the entire report carefully.

The intent of the property inspection is to identify and communicate conditions of the facility and components of the facility that are categorized and listed on the inspection form, particularly maintenance issues. The inspection is a visual review of readily accessible areas and components. The inspector will endeavor to observe the operation of mechanical and electrical systems and note the condition of the systems. It is not technically exhaustive and no excavation, disassembly or removal of covers, panels or obstructions is performed. Hidden or obstructed defects may not be observed.

Inspection Date: Inspector: Joe Smith



		Sa	mple R	eport	, 1452	2 N	Iain, A	'n	ycity, , 45845					
GRADIN	G / DRAINAG	E		_			[7	Monitor Condition	ACC	MAR	NI	NP	DEF
								7	Recommend Repairs					Ø
☑ Near Lev	vel .		Positive Slo	ope			Negative	Sl	ope \square	Pond	ing			
Comments:	building on the waside is dirt that h	vest a as se buil	nd north s ttled for th ding near t	ides, a le two f he tran	sphalt eet ne sform	on xt to er tl	the rear(o the fou here is n	(ea inc eg	l conditions . The cor ast) and the east dation - typical improp ative grading towards ntractor.	er bac	kfill. (On th		
	Grading / Drainage:						Gradin	ng /	Drainage:					
PARKIN	G LOT								Monitor Condition Recommend Repairs	ACC	MAR	NI	NP	DEF
			A 1 1			_				- L				
☐ Concrete ☐ General	Deterioration		Asphalt Cracks				Brick Settlemen	nt		Grave	eı			
Comments:	evident. There is	a stı	eam that r	uns fro	m the	eas	st to the	no	ealing. No parking lot orth along the east sid Recycle bins are loca	e of th	e prop	erty.		

8/22/2011

Inspection Date:

Inspector: Joe Smith



Sample Report, 1452 Main, Anycity, , 45845

R	OOFING			☐ Monitor Condition		ACC	MAR	NI	NP	DEF
				☑ Recommend Repair	rs					Ø
Age	e :	Des	sign Life :			10	00 % V	isible		
	Visual From Ground	\square	Walked On	Ladder at Eaves		Snow	Covere	d		
	Asphalt / Composition		Wood Shake	Wood Shingle		Tile				
	Tar and Gravel		Metal	Rolled Composition		Slate				
$\overline{\mathbf{V}}$	Membrane									
$\overline{\mathbf{V}}$	Suspected Leak(s)		Missing Shingle(s)	Cupping/Curling/Lifting/Brittle	\square	Previo	us Rep	airs N	Voted]
	Excessive Granular Loss	V	Bubbling	Trim Trees / Branches		Impro	per Inst	allati	on	

Comments: Leaks not always detectable.

The roof covering appears to be Modified Bitumen, it appears to be original to the building and is approximately 18 years in age. Cracking and bubbling noted in several areas, some of the cracks appear to be leaking. The roof slopes from front to rear. Some ponding near drains. One plumbing vent flashing has been repaired in an unprofessional manner. Recommend evaluation and repairs completed by a qualified roofing contractor. Noted dissimilar materials used in repairs, see flashing.





Roofing:

Roofing:

Inspection Date: Inspector: Joe Smith



		Sa	mple Report,	1452 N	Main, Anyc	eity, , 458	45					
E	XTERIOR SURFAC	CE			☑	Monitor Co	ndition 🗹	I Rec	ommen	d Re	pairs	1
								ACC	MAR	NI	NP	DEF
SII	DING/TRIM								V			
EX	TERIOR FAUCETS								Ø			
EX	TERIOR ELECTRICAL OU	JTLETS	□ NO GFCI									Ø
EX	TERIOR LIGHTING							Ø				
	Wood		Metal		Vinyl		Stucco					
	Synthetic Stucco		Composite		Veneer		Brick					
	General Deterioration		Needs Paint		Missing / Loose	e 🗆	Cracked					
	Needs Caulk / Seal		Poor Earth / Siding C	learance								

Comments:

Block exterior in fair conditions, small dings in surface with minimal cracking in surface. The EIFS on the East side of the building has pockets of damage an exposed foam in several areas. Several penetrations in wall surface need to be sealed. Some of the faucet covers are missing and damaged. Exterior outlets are missing covers. Exterior lights appear to be in good condition, not operated. Recommend repairs to the EIFS, sealing penetrations, faucet outlet covers.



Exterior Surface:



Exterior Surface:



Exterior Surface:



Exterior Surface:

Inspection Date: Inspector: Joe Smith



	Sa	mple Report, 145	52 N	Main, An	ycity, , 45845					
WINDOWS					Monitor Condition	ACC	MAR	NI	NP	DEF
					Recommend Repairs	\square				
□ Wood		Vinyl		Metal						
☐ Insulated Panes		Single Pane		Window We						
☐ General Deterioration		Needs Caulk / Seal			Damaged Storm Windows	S				
□ Needs Paint / Finish		Fogged		Painted Shut	t					
Comments: Metal insulated w	rindo	ws, appear to be in go	od d	condition.						
MAIN DOORS					Monitor Condition	ACC	MAR	NI	NP	DEF
					Recommend Repairs					
□ Wood □ Metal		Vinyl Fibe	_							
☐ General Deterioration		Delaminated / Damaged		•	-	Doorbel	_			
☐ Screen / Storm Door Damaged	Ш	Evidence of Leak(s)		Repair/Repla	ace Weather-Strip	Needs C	Caulk / S	Seal		
Main Doors:		2809		Main Doo	DELIVERY ENTRANCE	18.5				
FRIEGHT DOOR					Monitor Condition Recommend Repairs	ACC	MAR	NI	NP	DEF
□ Wood □ Metal		Vinyl Fibe	rglas							
☐ General Deterioration☐ Screen / Storm Door Damaged		Delaminated / Damaged Evidence of Leak(s)		-	-	Doorbel Needs C	-			
	ope	erates properly and is in			*			. ***		



Sample Report, 1452 Main, Anycity, , 45845





Frieght Door:

Frieght Door:

DUNDATION				□ Mo:	onitor Condition	ACC	MAR	NI	NP	DEF
				□ Rec	commend Repairs	\square				
Concrete Block		Concrete		Slab		Post / Pi	er			
Brick		Stone		Wood		Insulated	d Conci	ete F	orms	(ICF)
General Deterioration		Horizontal Cracks		Step Cracks		Vertical	Cracks			
Limited Observation		Needs Caulk / Seal		Trim Vegetation	n 🗆	Sub-Gra	de Entr	yway		
	Brick General Deterioration	Concrete Block Brick General Deterioration	Concrete Block	Concrete Block	Concrete Block	Concrete Block	Concrete Block	Concrete Block	Concrete Block	Concrete Block

Comments: Foundation appears to be concrete block on a continuous concrete footing. Limited visibility to foundation.



Foundation: Damage to the base of the marquis

Inspection Date: Inspector: Joe Smith



		Sa	mple Report, 1	1452 N	Main, Any	city, , 45845	5					
ST	TRUCTURAL FRAM	IE AN	D BUIILDING			Monitor Conditio	n	ACC	MAR	NI	NP DE	F
E	NVELOPE					Recommend Repa	airs		V			
$\overline{\checkmark}$	Concrete Block		Concrete		Slab			Post / Pie	er			
	Brick		Stone		Wood			Insulated	l Conci	ete Fo	orms (ICI	(
	General Deterioration		Horizontal Cracks		Step Cracks			Vertical	Cracks			
	Limited Observation		Needs Caulk / Seal		Trim Vegetat	ion		Sub-Gra	de Entr	yway		
	and repair as n	Y DAY				MILLION						
IN	TERIOR FOUNDAT	ΓΙΟΝ				Monitor Conditio		ACC	MAR	NI	NP DE	F
_						Recommend Repa						_
	General Deterioration		Horizontal Cracks		Step Cracks	_		ical Crac				
	Limited Observation		Leaning / Bowing		Inadequate V	entilation \square	Efflo	rescence	/ Susp	ected	Leak(s)	
	mments :											_

Inspection Date: Inspector: Joe Smith



Sample Report, 1452 Main, Anycity, , 45845

Summary

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

GRADING / DRAINAGE

Defective

Positive grading around most of the building with near level conditions . The concrete walks line the building on the west and north sides, asphalt on the rear(east) and the east side is dirt that has settled for the two feet next to the foundation - typical improper backfill. On the South side of the building near the transformer there is negative grading towards the building. Recommend further evaluation and repair by landscape contractor.

FENCES / ENCLOSURES

Defective

No enclosure present, however compactor is located at the rear of the store. The lower portions of the marguis are deteriorated and in need of repair.

ROOFING Defective

The roof covering appears to be Modified Bitumen, it appears to be original to the building and is approximately 18 years in age. Cracking and bubbling noted in several areas, some of the cracks appear to be leaking. The roof slopes from front to rear. Some ponding near drains. One plumbing vent flashing has been repaired in an unprofessional manner. Recommend evaluation and repairs completed by a qualified roofing contractor. Noted dissimilar materials used in repairs, see flashing.

MANSARD ROOF

Defective

The mansard roof covering is a concrete tile product, at least one broken tile was noted, the remainder of the roof seemed to be in good condition. Recommend replacing broken tile.

FLASHING/VALLEYS

Defective

Flashing appears to be in poor condition, cracking and evidence of ponding water near the drains. Repairs have been made using what appears to be dissimilar material. Please see the plumbing boot comment in the roof section. Recommend evaluation and repairs by a qualified roofing contractor.

Inspection Date: Inspector: Joe Smith



Sample Report, 1452 Main, Anycity, , 45845

GUTTERS/DOWN SPOUTS

Defective

Gutters appear to be in good condition. The area around the drains show signs of ponding. One downspout appears to have received impact blows, doing damage that could affect the flow of water through the downspout. Recommend replacement of the downspout.

EXTERIOR SURFACE

Siding/Trim

Marginal

Exterior Faucets

Marginal

Exterior Electrical Outlets

Defective

Block exterior in fair conditions, small dings in surface with minimal cracking in surface. The EIFS on the East side of the building has pockets of damage an exposed foam in several areas. Several penetrations in wall surface need to be sealed. Some of the faucet covers are missing and damaged. Exterior outlets are missing covers. Exterior lights appear to be in good condition, not operated. Recommend repairs to the EIFS, sealing penetrations, faucet outlet covers.

STRUCTURAL FRAME AND BUILDING ENVELOPE

Marginal

Building Envelope is concrete block, appears to be in fair condition. One hairline crack visible on the front of the building, no differential separation. Recommend monitoring for further movement and repair as needed.

Main Building - Main Unit

WATER HEATER

Defective

19 gallon AO Smith water heater, manufactured in 1993 has rust and corrosion on the top sides and bottom of the tank. Appears to be currently holding water, yet rust and water stains on the floor indicate ongoing leakage. Recommend replacement of the water heater.

SALES FLOOR

Ceilings

Marginal

Several stained ceiling tile should replace when roof repairs complete.

Inspection Date: 8/22/2011

Inspector: Joe Smith



Sample Report, 1452 Main, Anycity, , 45845

BACK ROOM/STORAGE ROOM

Ceilings Defective

Noted water stains on ceiling beam over loading area, appears dry at time of inspection. Roof hatch holding latch is not fastened, appears screws have pulled out. Recommend repairs to hatch.

EMPLOYEE OFFICE/LOUNGE

Interior Doors/Hardware Defective

Interior door knob is damaged, recommend repair.

- ' '	The item/system was marginally acceptable. (It performed its designed function as of the time of the inspection. However, due to age and/or deterioration, it will likely require early repair or replacement.)

DEF (**DEFECTIVE**) The item/system failed to operate/perform its intended function, was structurally deficient, was unsafe or was hazardous at the time of the inspection.

Inspection Date: Inspector: Joe Smith