NPI

Property Inspector Pros DBA

National Property Inspections

Sample



Saturday, August 22, 2020 Inspector

Eddie Restani 312-771-1293



National Property Inspections

Sample									
GENERAL INFORMATION									
GENERAL CO	GENERAL CONDITIONS AT TIME OF INSPECTION:								
Property Occupied : Estimated Age Of Property Faces :	Yes perty: 32 Year(s) North ☑ South □ East □ West	Temperature : 74 Weather : ☑ Sunny	F						
Type of Property: ☑ Multi-Family Primary Construction	:	Soil Conditions : ☑ Dry Persons Present :							
☑ Brick	☑ Wood	☑ Buyer	☑ Buyer's Agent						

DEFINITIONS:

Below are listed the definitions used throughout the report to describe each feature of the property.

ACC (ACCEPTABLE) The item/system was performing its intended function at the time of the inspection.

MAR (MARGINAL) The item/system was marginally acceptable. It performed its designed function at the time of the

inspection. However, due to age and/or deterioration, it will likely require early repair or replacement.

NI (NOT INSPECTED) The item/system was not inspected due to safety concerns, inaccessibility and/or concealment or seasonal

conditions and no representations of whether or not it was functioning as intended were made.

NP (NOT PRESENT) The item/system does not exist or was visually concealed at the time of the inspection.

RR (REPAIR/REPLACE) The item/system failed to operate/perform its intended function, was structurally deficient, was unsafe or

was hazardous at the time of the inspection.

SCOPE OF THE INSPECTION:

We wish to remind you that every property requires a certain amount of ongoing maintenance: drains sometimes clog, gutters, downspouts and the grading around the property must be properly maintained to help prevent water intrusion in to the basement or crawlspace; roofs, furnaces, air conditioners and other components require regular maintenance and inspection. This property will be no exception and we strongly suggest that you both expect and budget for regular maintenance/repairs.

The following report is based on visual inspection of the readily accessible areas of this property and on a random sampling of like items, <u>not every item was or could be inspected</u>. Please read the entire report carefully, ask your inspector any questions you might have <u>and obtain estimates or discuss noted items with a contractor before</u> closing.



National Property Inspections

Sample

GRADING / DRAINAGE ACC MAR NI NP RR D D D D

☑ Near Level ☑ Negative Slope ☑ Positive Slope

Comments:

Exterior grounds and coverings believed to be maintained by the HOA (Home Owners Association). Any areas of concern may need to be addressed with the HOA

The grading on this property was positive, near level and negative. This condition may allow water to accumulate around the house during rains and has the potential to allow water to enter the dwelling. Monitor condition during rains as improvements in grading/drainage may be needed.



Grading / Drainage: Negative slope.



Grading / Drainage:



Grading / Drainage:



Grading / Drainage:



National Property Inspections

Sample

	ACC	MAR	NI	NP	RR
DRIVEWAY					

☑ Brick ☑ General Deterioration ☑ Settlement

Comments:

All driveways are believed to be maintained by the HOA (Home Owners Association). Any areas of concern may need to be addressed with the HOA.







Driveway:

		A	CC	MAR	NI	NP	RR
WALKS / STEPS			V				
☑ Brick	☑ Cracks/Settlement						

Comments:

All exterior and grounds are believed to be maintained by HOA (Home Owners Association). Any areas of concern may need to be addressed with the HOA.

Previous repairs noted.



National Property Inspections

Sample



Walks / Steps:

PORCHES / STOOPS

ACC MAR NI NP RR
☑ □ □ □ □

☑ Open ☑ General Deterioration ☑ Settlement

Comments:

All exterior and grounds are believed to be maintained by HOA (Home Owners Association). Any areas of concern may need to be addressed with the HOA. Previous repairs noted.



Porches / Stoops:



Porches / Stoops:



National Property Inspections

Sample

			ACC	MAR	NI	NP	RR
PATIO			\square				
☑ Brick	☐ General Deterioration	☑ Settlement					

☑ Brick ☑General Deterioration

Comments:

All exterior and grounds are believed to be maintained by HOA (Home Owners Association). Any areas of concern may need to be addressed with the HOA.



Patio:





Patio:

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293



National Property Inspections

Sample

	ACC	MAR	NI	NP	RR
ROOFING	$\overline{\mathbf{A}}$				

Age: 5-10 Year(s) Design Life: 15-20 Year(s)

☑ Asphalt / Composition

Comments:

All exterior roof coverings and structures are believed to be maintained by HOA (Home Owners Association). Any areas of concern may need to be addressed with the HOA.

Leaks not always detectable.



Roofing:



Roofing:



Roofing:



Roofing:

Inspection Date: Inspector: Eddie Restani Er 08/22/2020 Inspector Phone: 312-771-1293 45



National Property Inspections

Sample



Roofing:

FLASHING/VALLEYS

☑ Composition / Membrane ☑ Metal

ACC MAR NI NP RR

Comments:

Roof and valley flashings are believed to be maintained by the HOA (Home Owners Association). Any areas of concern may need to be addressed with the HOA.

☑ Filled with Debris



Flashing/Valleys:



Flashing/Valleys:

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293



National Property Inspections

Sample







ACC MAR

 $\overline{\mathbf{V}}$

NP

RR

Flashing/Valleys:

GUTTERS/DOWN SPOUTS

☑ Aluminum

☑ Filled with Debris

Comments:

All exterior gutters and downspouts are believed to be maintained by HOA (Home Owners Association). Any areas of concern may need to be addressed with the HOA. Recommend cleaning gutters.



Gutters/Down Spouts:



Gutters/Down Spouts:

Inspection Date: 08/22/2020


Inspector: Eddie Restani Inspector Phone: 312-771-1293



National Property Inspections

Sample



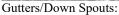



Gutters/Down Spouts:

CHIMNEY

☑ Brick / Masonry ☑ Framed

☑Metal

NP

RR

☑ General Deterioration

ACC MAR

Comments:

All exterior chimney and related structures are believed to be maintained by the HOA (Home Owners Association). Any areas of concern may need to be addressed with the HOA.

Flue not inspected. Annual cleaning is recommended.



Chimney:



Chimney:



National Property Inspections

Sample





Chimney:

Chimney:

EXTERIOR SURFACE

☑ Recommend Repairs

☑Brick	☑ General Deterioration					
		ACC	MAR	NI	NP	RR
SIDING/TRIM		Ø				
EXTERIOR FAUCETS		Ø				
EXTERIOR ELECTRICAL OUTLE	ETS					Ø
EXTERIOR LIGHTING		Ø				

Comments:

All exterior and grounds are believed to be maintained by HOA (Home Owners Association) repairs and improvements should be handled by the HOA as necessary.

Electrical outlet(s) at exterior was inoperable at the time of the inspection.

Outlet did not have a weather cap that allows long term fixtures to be plugged in while cap is closed. Recommend replacing with a weather cap cover that accommodates plug.

Recommend further evaluation/repair by qualified contractor.



National Property Inspections

Sample



Exterior Surface:



Exterior Surface:



Exterior Surface:



Exterior Surface:

			ACC	MAR	NI	NP	RR
WINDOWS			\square				
✓Vinyl	☑Wood	☐ General Deterioration					

Comments:

Random sampling of windows was performed and appeared to be in good condition.



National Property Inspections

Sample



Windows:



Windows:



Windows:

EXTERIOR DOORS

☑ Fiberglass	☑ Meta
---------------------	--------

Comments:

Doors appear to be functioning properly and seal properly when closed.

Inspection Date:Inspector: Eddie RestaniEmail: Eddie.Restani@npiinspect.com08/22/2020Inspector Phone: 312-771-1293450.012272Expires: 11/30/2020

ACC MAR

NI

NP

RR



National Property Inspections

Sample







ACC MAR

 $\overline{\mathbf{V}}$

NP

RR

NI

Exterior Doors:

FOUNDATION

☑ Concrete

☑ General Deterioration

Comments:

All visible exterior foundation walls appear in acceptable condition at time of inspection with no major defects or movement noted.



Foundation:



Foundation:

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293



National Property Inspections

Sample

GARAGE/CARPORT ☑ Rec			end Repairs					
☑2 Cars	☑ Attached	☑ Cracked	⊠E	Electrical Deficiencies				
Outlets (NOT GFCI) Protected							
				ACC	MAR	NI	NP	RR
FLOOR/WALLS/CEILI	NG/ELECTRICAL							Ø
ROOF				Ø				
SIDING/TRIM				V				

Comments:

After testing electric receptacle(s) with a tester and pushing the test button(s), it was determined that the wall receptacle(s) were not GFCI protected. Receptacles in a carport/garage have been required to be GFCI protected since 1978, except for garage door opener receptacle. Light inoperable.

Hole/opening needs to be covered.

Recommend further evaluation/repair by qualified contractor(s).



Garage/Carport:



Garage/Carport:



National Property Inspections

Sample



Garage/Carport:



Garage/Carport:



Garage/Carport:



Garage/Carport:

OVERHE	ADCARA	CE DOORS

☑ Recommend Repairs

ACC	MAR	NI	NP	RR
				V

of Openers: 2

Metal

☑ Repair / Adjust Automatic Reverse

Comments:

Automatic reverse on garage door was missing or not operating.

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293




National Property Inspections

Sample



Overhead Garage Doors:

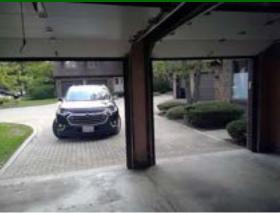

Overhead Garage Doors:

GARAGE PEDESTRIAN DOOR INTO HOUSE

ACC MAR NI NP RR

Comments:

Door had self closure and seals were acceptable.



Garage Pedestrian Door into House:

Attic / Roof

Method of Inspection ☐ Physical Entry

☑ Visual from Access

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293



National Property Inspections

Sample

ATTIC FRAMING/SHEATHING

ACC	MAR	NI	NP	RR
V				

☑Rafters

Comments:

All the framing and sheathing that was visible from the attic was acceptable at time of inspection.


Leaks not always detectable.



Attic Framing/Sheathing:



Attic Framing/Sheathing:

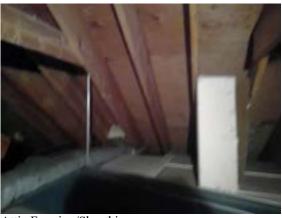

Attic Framing/Sheathing:



Attic Framing/Sheathing:




National Property Inspections

Sample



Attic Framing/Sheathing:

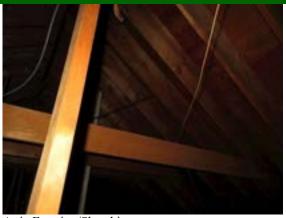

ACC MAR

 $\overline{\mathbf{V}}$

NP

RR

Attic Framing/Sheathing:

ATTIC VENTILATION


☐ Gable ☐ Soffit ☐ Static Vent

Comments:

At time of inspection ventilation was acceptable.



Attic Ventilation:

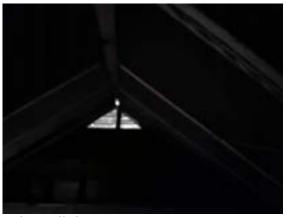

Attic Ventilation:



National Property Inspections

Sample



Attic Ventilation:



ACC MAR

 $\overline{\mathbf{V}}$

NP

RR

Attic Ventilation:

ATTIC INSULATION

☑Blanket

Comments:

Insulation acceptable at time of inspection.



Attic Insulation:



Attic Insulation:

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293



National Property Inspections

Sample

ATTIC ELECTRICAL

ACC MAR NI NP RR

Comments:

Cannot inspect attic utilities (electrical, gas, plumbing, etc.) due to obstruction and hazard.

Limited visibility due to obstructions. See Electrical Section for additional Information.







Attic Electrical:

Interior Foundation

INTERIOR FOUNDATION

ACC	MAR	NI	NP	RR
Ø				

☑ General Deterioration

Comments:

Settlement type cracks, previous moisture and repairs observed. Appeared typical at this time. Monitor regularly and evaluate/repair as required.



National Property Inspections

Sample



Interior Foundation:



Interior Foundation:



Interior Foundation:



Interior Foundation:

UNDER	FLOOR FRAMING & SUPPORT	ACC	MAR	NI	NP	RR
BEAMS	✓Steel	Ø				
JOISTS	☑ Dimensional Lumber	Ø				
POSTS					Ø	
PIERS	☑Block ☑Concrete	Ø				

Comments:



National Property Inspections

Sample



Under Floor Framing & Support:





Under Floor Framing & Support:



Under Floor Framing & Support:

FLOOR/SLAB

ACC	MAR	NI	NP	RR
V				

Comments:

All visible concrete flooring was in good condition at time of inspection with no major defects noted.

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293



National Property Inspections

Sample





Floor/Slab: Floor/Slab:

ELECTRICAL

☑ Recommend Repairs

SERVICE SIZE (Main Panel)

☐ Brand: GE ☐ Main Disconnect Location: Utility room

☑ 120 / 240 Volt (Nominal)

☑ 100 AMP

SERVICE Underground ENTRANCE CABLE	ACC	MAR	NI 🗆	NP	RR □
ENTRANCE CABLE	Ø				
DANIEL	IJ		Ц		
PANEL					
SUB-PANEL				Ø	
BRANCH CIRCUITS					Ø
BONDING/GROUNDING	Ø				
GFCI(IN PANEL)*					Ø
ARC FAULT				Ø	
SMOKE DETECTORS*					V
CLOSETS					V

Comments:



National Property Inspections

Sample

Some lights in house turned on and off by themselves and or were flickering. GFCI breaker triple tapped.

Some wires frayed in electrical panel.

Be aware of exposed bulb in closet. Items close to, or in contact with, bulb could ignite. Lights in closets should be in an enclosed fixture for fire safety.

Recommend adding smoke/carbon monoxide detectors to all living rooms, hallways, bedrooms and kitchen area for safety.

Recommend further evaluation/repair by qualified contractor(s).

*Smoke Detectors / GFCI's checked with test button only. Monthly Test Recommended.



Electrical:



Electrical:



Electrical:



Electrical:

NPI

Property Inspector Pros DBA

National Property Inspections

Sample




Electrical:



Electrical:



Electrical: Triple wire tapped.

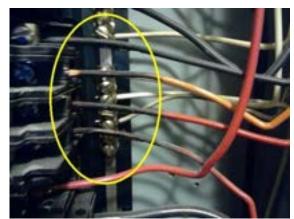

Electrical: Several wires appeared to be frayed.

PLUMBING

Water Service

☑ Water Public

Sewage Service

☑ Sewage Public

Fuel Service

☑ Shut Off Location: Exterior rear

☐ General Deterioration

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293



National Property Inspections

Sample

	ACC	MAR	NI	NP	RR
SUPPLY	Ø				
DRAINS	☑				
EJECTOR PUMP				Ø	
VENTS	Ø				

Comments:

No defects were found pertaining to the main plumbing system.

Main utility line, septic systems and gray water systems are excluded from this Inspection.



Plumbing:



Plumbing:



Plumbing:



National Property Inspections

Sample

			ACC	MAR	NI	NP	RR
WATER HEATER		☑ Monitor Condition		V			
Brand: Fury	Size: 50	Age: 14 Year(s) De	sign Li	e: 10-1	2 Yea	ır(s)	

SerialNo: RHLN 0106504678

☑ Gas

Comments:

Most water heaters have a life span of ten to twelve years. Unit was functional, but was rated marginal due to its age. Ultimately, you should consider budgeting for replacement of the hot water heater in the foreseeable future.



Water Heater:



Water Heater:



Water Heater:

Inspector: Eddie Restani Inspection Date: Email: Eddie.Restani@npiinspect.com Inspector Phone: 312-771-1293 08/22/2020 450.012272 Expires: 11/30/2020



National Property Inspections

Sample

LAUNDRY FACILITIES	☑ Recommend Repairs	ACC	MAR	NI	NP	RR
UTILITY HOOKUPS						Ø
DRYER VENTS		Ø				
LAUNDRY TUB		Ø				
DRAIN		V				

Comments:

Black rubber feeder hoses could burst. Recommend replacing with one-piece braided type hoses.



Laundry Facilities:



Laundry Facilities:

HEATING Monitor Condition									
Brand: Carrier	Age: 15 Year(s)	Age: 15 Year(s) Design Life: 15-20 Year(s)		SerialNo: 3105A01626					
 Gas	☑ Forced Air								
			ACC	MAR	NI	NP	RR		
OPERATION				Ø					
ABOVE GROUND STOR	AGE TANKS					Ø			
HUMIDIFIER			Ø						

Comments:

Rated marginal due to age. Unit functional at time of inspection.

Heat Exchanger - Unable to detect cracks/holes without dismantling unit.



National Property Inspections

Sample







ACC MAR

 $\overline{\mathbf{V}}$

NP

RR

Heating:

DRAFT CONTROL/VENT

_ ☑PVC

Comments:

The furnace flue pipes were installed and venting properly.



Draft Control/Vent:



National Property Inspections

Sample

HEATING DISTRIBUTION

	ACC	MAR	NI	NP	RR
DISTRIBUTION	V				
BLOWER	Ø				
CONTROLS/THERMOSTAT (CALIBRATIONS/TIMED FUNCTIONS NOT CHECKED.)	Ø				
CIRCULATOR PUMP				Ø	

Comments:

Distribution was acceptable at time of inspection.



Heating Distribution:



Heating Distribution:



Heating Distribution:



National Property Inspections

Sample

			A	CC	MAR	NI	NP	RR
COOLING		☑ Monitor Condition			Ø			
Brand: Carrier	Age: 15 Year(s)	Design Life: 10-15 Year(s)	Serial	SerialNo: 1805E15232				

☑Electric ☑Central Air

Comments:

Rated marginal due to age of unit. Budget for eventual replacement.



Cooling:



Cooling:



Cooling:



National Property Inspections

Sample

KITCHEN	☑ Recommend Repairs	ACC	MAR	NI	NP	RR
CEILINGS	E Recommend Repairs	ACC	MAK	NI 🗆	NP	
WALL(S)		☑				
WINDOWS/TRIM					Ø	
WINDOW SCREENS					Ø	
FLOOR/FINISH		Ø				
INTERIOR DOORS/HARDWARE		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST	RECOMMENDED.)					Ø
HEAT/AIR DISTRIBUTION		\square				
COUNTERTOPS/CABINETS		\square				
SINK/FAUCET		\square				
EXHAUST FAN		\square				
STOVE TOP/OVEN		Ø				
STOVE ANTI-TIP BRACKET		\square				
WATER PRESSURE/FLOW/DRAINAGE		\square				
DISHWASHER/CROSS FLOW PROTECTION		\square				
REFRIGERATOR		\square				
MICROWAVE		\square				
GARBAGE DISPOSAL		V				

Comments:

A Ground Fault Circuit Interrupter (GFCI) electrical outlet in the kitchen did not respond to the test button. Recommend further evaluation/repair by qualified contractor(s).



National Property Inspections

Sample



Kitchen:



Kitchen:



Kitchen:

FIREPLACE/STOVE

ACC	MAR	NI	NP	RR
V				

☑Gas Log

Comments:

Fireplace was in good condition with operational flue damper.

Recommend annual cleaning - Fireplace design and soot / creosote buildup, in most cases, prevents view of chimney liner / cracks.

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293



National Property Inspections

Sample



Fireplace/Stove:

BATHROOM		MAD	NII	NID	DD
	_	MAR	NI	NP	RR
CEILINGS	☑				
WALL(S)	Ø				
WINDOWS/TRIM				Ø	
WINDOW SCREENS				Ø	
FLOOR/FINISH	Ø				
INTERIOR DOORS/HARDWARE	V				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION	V				
COUNTERTOPS/CABINETS	Ø				
SINK/FAUCET	Ø				
TOILET	Ø				
TUB/SHOWER	V				
JETTED TUB				Ø	
TILE WORK/ENCLOSURE	V				
EXHAUST FAN	Ø				
WATER PRESSURE/FLOW/DRAINAGE	Ø				



National Property Inspections

Sample

Comments:

All components in bathroom were acceptable at time of inspection.







Bathroom:

MASTER BATHROOM	ACC	MAR	NI	NP	RR
CEILINGS	V				
WALL(S)	Ø				
WINDOWS/TRIM	Ø				
WINDOW SCREENS	Ø				
FLOOR/FINISH	Ø				
INTERIOR DOORS/HARDWARE	Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	Ø				
GFCI PROTECTION (CHECKED WITH TEST BUTTON ONLY. MONTHLY TEST RECOMMENDED.)	Ø				
HEAT/AIR DISTRIBUTION	Ø				
COUNTERTOPS/CABINETS	Ø				
SINK/FAUCET	Ø				
TOILET	Ø				
TUB/SHOWER	Ø				
JETTED TUB	Ø				
TILE WORK/ENCLOSURE	Ø				
EXHAUST FAN	V				
WATER PRESSURE/FLOW/DRAINAGE	V				



National Property Inspections

Sample

Comments:

All components in bathroom were acceptable at time of inspection.



Master Bathroom:



Master Bathroom:



Master Bathroom:



National Property Inspections

Sample

ENTRANCE/DINING ROOM	☑ Recommend Repairs	ACC	MAR	NI	NP	RR
CEILINGS		Ø				
WALLS		Ø				
WINDOWS/TRIM		Ø				
WINDOW SCREENS		Ø				
FLOOR/FINISH						Ø
INTERIOR DOORS/HARDWARE		Ø				
CLOSET		Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)		Ø				
HEAT/AIR DISTRIBUTION		Ø				

Comments:

Floors were uneven and sloped. This may indicate improper settlement or deterioration of the framing. Recommend further evaluation/repair by qualified contractor(s).



Entrance/Dining Room: Floor uneven and popping up.



Entrance/Dining Room:




National Property Inspections

Sample



Entrance/Dining Room:

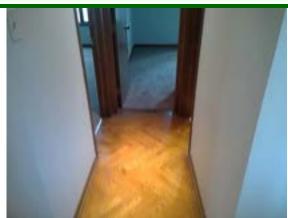

Entrance/Dining Room:



Entrance/Dining Room:

BEDROOM 1	ACC	MAR	NI	NP	RR
CEILINGS	☑				
WALLS	Ø				
WINDOWS/TRIM	V				
WINDOW SCREENS	V				
FLOOR/FINISH	V				
INTERIOR DOORS/HARDWARE	Ø				
CLOSET	V				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	V				
HEAT/AIR DISTRIBUTION	Ø				



National Property Inspections

Sample

Comments:

Ceiling, walls, window(s), lights and receptacles were acceptable.



Bedroom 1:



Bedroom 1:

MASTER BEDROOM 2	ACC	MAR	NI	NP	RR
CEILINGS	Ø				
WALLS	Ø				
WINDOWS/TRIM	Ø				
WINDOW SCREENS	Ø				
FLOOR/FINISH	Ø				
INTERIOR DOORS/HARDWARE	Ø				
CLOSET	Ø				
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	Ø				
HEAT/AIR DISTRIBUTION	Ø				



National Property Inspections

Sample

Comments:

Ceiling, walls, window(s), lights and receptacles were acceptable.



Master Bedroom 2:



Master Bedroom 2:

FAMILY/BREAKFAST	ACC	MAR	NI	NP	RR
CEILINGS	Ø				
WALLS	\square				
WINDOWS/TRIM	Ø				
WINDOW SCREENS	Ø				
FLOOR/FINISH	Ø				
INTERIOR DOORS/HARDWARE	Ø				
CLOSET				Ø	
ELECTRICAL (RANDOM SAMPLING OF OUTLETS, SWITCHES, FIXTURES.)	Ø				
HEAT/AIR DISTRIBUTION	Ø				



National Property Inspections

Sample

Comments:

Ceiling, walls, window(s), lights and receptacles were acceptable.



Family/Breakfast:



Family/Breakfast:



Family/Breakfast:



Family/Breakfast:



National Property Inspections

Sample



Family/Breakfast:

SCREENS

ACC MAR NI NP RR

Comments:

Several screens missing throughout the house. Some screens were stored in the attic. Recommend replacing missing screens.



Screens:



☑ Recommend Repairs

Screens:



National Property Inspections

Sample

Summary

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

1 EXTERIOR SURFACE

Exterior Electrical Outlets

REPAIR/REPLACE

All exterior and grounds are believed to be maintained by HOA (Home Owners Association) repairs and improvements should be handled by the HOA as necessary.

Electrical outlet(s) at exterior was inoperable at the time of the inspection.

Outlet did not have a weather cap that allows long term fixtures to be plugged in while cap is closed.

Recommend replacing with a weather cap cover that accommodates plug.

Recommend further evaluation/repair by qualified contractor.



EXTERIOR SURFACE:

©1996-2020



National Property Inspections

Sample

2 GARAGE/CARPORT

Floor/Walls/Ceiling/Electrical

REPAIR/REPLACE

After testing electric receptacle(s) with a tester and pushing the test button(s), it was determined that the wall receptacle(s) were not GFCI protected. Receptacles in a carport/garage have been required to be GFCI protected since 1978, except for garage door opener receptacle. Light inoperable.

Hole/opening needs to be covered.

Recommend further evaluation/repair by qualified contractor(s).



GARAGE/CARPORT:



GARAGE/CARPORT:



National Property Inspections

Sample

3 OVERHEAD GARAGE DOORS

REPAIR/REPLACE

Automatic reverse on garage door was missing or not operating.

4 ELECTRICAL

Branch Circuits

GFCI(in panel)*

REPAIR/REPLACE

REPAIR/REPLACE

REPAIR/REPLACE

Closets

REPAIR/REPLACE

Some lights in house turned on and off by themselves and or were flickering.

GFCI breaker triple tapped. Some wires frayed in electrical panel.

Be aware of exposed bulb in closet. Items close to, or in contact with, bulb could ignite. Lights in closets should be in an enclosed fixture for fire safety.

Recommend adding smoke/carbon monoxide detectors to all living rooms, hallways, bedrooms and kitchen area for safety.

Recommend further evaluation/repair by qualified contractor(s).







ELECTRICAL:



National Property Inspections


Sample



ELECTRICAL:



ELECTRICAL: Triple wire tapped.

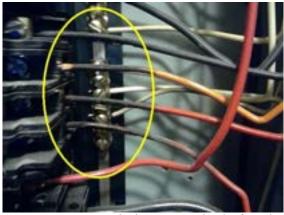

ELECTRICAL: Several wires appeared to be frayed.



National Property Inspections

Sample

5 WATER HEATER MARGINAL

Most water heaters have a life span of ten to twelve years. Unit was functional, but was rated marginal due to its age. Ultimately, you should consider budgeting for replacement of the hot water heater in the foreseeable future.



WATER HEATER:

©1996-2020



National Property Inspections

Sample

6 LAUNDRY FACILITIES

Utility Hookups REPAIR/REPLACE

Black rubber feeder hoses could burst. Recommend replacing with one-piece braided type hoses.



LAUNDRY FACILITIES:

7 HEATING

Operation MARGINAL

Rated marginal due to age. Unit functional at time of inspection.



HEATING:

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293 Email: Eddie.Restani@npiinspect.com 450.012272 Expires: 11/30/2020



National Property Inspections

Sample

8 COOLING MARGINAL

Rated marginal due to age of unit. Budget for eventual replacement.



COOLING:

9 KITCHEN

GFCI Protection (Checked with Test Button Only. Monthly Test Recommended.)

REPAIR/REPLACE

A Ground Fault Circuit Interrupter (GFCI) electrical outlet in the kitchen did not respond to the test button.

Recommend further evaluation/repair by qualified contractor(s).



KITCHEN:

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293 Email: Eddie.Restani@npiinspect.com 450.012272 Expires: 11/30/2020



National Property Inspections

Sample

10 ENTRANCE/DINING ROOM

Floor/Finish REPAIR/REPLACE

Floors were uneven and sloped. This may indicate improper settlement or deterioration of the framing. Recommend further evaluation/repair by qualified contractor(s).



ENTRANCE/DINING ROOM: Floor uneven and popping up.

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293 Email: Eddie.Restani@npiinspect.com 450.012272 Expires: 11/30/2020



National Property Inspections

Sample

11 SCREENS REPAIR/REPLACE

Several screens missing throughout the house. Some screens were stored in the attic. Recommend replacing missing screens.



SCREENS:



SCREENS:

MAR (MARGINAL)

RR (REPAIR/REPLACE)

The item/system was marginally acceptable. It performed its designed function at the time of the inspection. However, due to age and/or deterioration, it will likely require early repair or replacement.

The item/system failed to operate/perform its intended function, was structurally deficient, was unsafe or was hazardous at the time of the inspection.

Inspection Date: 08/22/2020

Inspector: Eddie Restani Inspector Phone: 312-771-1293 Email: Eddie.Restani@npiinspect.com 450.012272 Expires: 11/30/2020



National Property Inspections

Sample

Limited Warranty

The Limited Warranty, for mechanical systems and appliances, is free of charge in conjunction with a home inspection performed by Eddie Restani with the following conditions:

- 1. The fee for the home inspection must be received by National Property Inspections within 10 days from the date of the inspection.
- This warranty begins when the fee for the home inspection is received and expires 90 days from the date of the inspection.
- 3. If there are any other insurance policies or warranties applicable, this warranty becomes excess.
- 4. This warranty applies only to those mechanical systems and/or applicances identified in the NPI Inspection Report which details the inspector's findings at the property.

Address of Property Inspected:

Date inspected: 8/22/2020

The following items are excluded from protection under this Limited Warranty due to the fact that they need servicing, were dysfunctional or inoperative at the time of the inspection or near the end of their normal life expectancy.

Air Conditioner was not inspected due to outside temperature and due to it being at or past its design life of 10-15 years.

Washer and Dryer not part of warranty.

Electrical-Defective lighting, wiring and tapping.

Furnace excluded as it was at or past its design life of 15 to 20 years.

No Smoke Detectors.

TERMS, LIMITATIONS AND DEDUCTIBLE -- READ CAREFULLY.

National Property Inspections (hereinafter NPI) will, during the term of this Limited Warranty, repair or replace at its option, the protected items and components should they become inoperative due to mechanical failure, subject to the terms, limitations, and deductible specified below. This Limited Warranty covers only those mechanical systems and appliances listed below.

- I. Warranty Limit:
 - A. NPI's maximum liability under this warranty for all mechanical defects arising during, and not preexisting to, the 90 days warranty term is limited to \$2,500. All mechanical claims carry a \$250 deductible.
- II. To present a claim:
 - A. Call the NPI inspector first, not a service contractor. NPI will not pay for any service that is not authorized in advance. The client is expected to make any necessary temporary repairs to prevent any further damage to the item(s) in question.
 - B. Payment of the \$250 deductible is the responsibility of the client for each service call for each protected

NPI

Property Inspector Pros DBA

National Property Inspections

Sample

item. The deductible must be paid directly to the contractor affecting authorized repairs or replacement.

- C. NPI has the sole option to repair or replace.
- D. The client must promptly notify NPI when any covered item(s) has a mechanical failure. NPI shall have no responsibility for claims which are not reported within 5 days of its mechanical failure.

III. Protection Limit:

- A. NPI will not pay for repair or replacement as a result of fire, wind, rain, hail, freezing, smoke, lightning, flood, earthquake, storm, theft, accidents, vandalism, riot, power failure, pest or insect damage, lack of capacity, inadequacy, improper installation, negligence, alterations, modifications, consequential damages of any kind, or acts of God.
- B. NPI will make no reimbursement for materials or labor it did not authorize.
- C. NPI will not be liable for the expense to open or close walls, floors, or ceilings, nor for the removal and replacement of tiles, carpet, wallpaper or vinyl to perform a covered service.
- D. If the client performs or authorizes any repairs, alterations, or installations, or modifies any protected item or component or causes any consequential damage, NPI will have no responsibility with regard to that item
- E. If the covered property is a condominium or similar ownership, NPI will not pay for repairs or service beyond the interior of the client's unit.
- F. NPI will not be liable for damage that results from contractor's delay of service such as riots or unavailability of parts or labor. NPI will not be responsible for color match.
- G. NPI will not pay to improve or upgrade an item or items due to lack of capacity, design or failure to meet building code or zoning requirements. Any expense incurred to meet code or zoning requirements, above that needed to remedy the mechanical failure, is the client's sole responsibility.
- IV. The NPI warranty is non-transferable. Should the client sell, vacate or rent the covered property, the warranty becomes null and void.
- V. If NPI waives a right under the warranty, it does not waive any additional or future rights.

PROTECTED ITEMS:

INTERIOR ELECTRICAL SYSTEMS: (\$1,000 maximum)

Covered: General wiring and components within the perimeter of the main foundation; the electrical

panel and subpanel. The following items are limited to a \$100.00 payment: fire alarm system;

door bells; smoke detection systems; garage door openers; receptacles.

Not Covered: Power failure or shortages; overload or inadequate wiring capacity; intercom systems; garage

door opener sending units; burglar alarm systems; exhaust, wall, attic, or ceiling fans; light

fixtures; any pre-existing condition.

INTERIOR PLUMBING SYSTEMS: (\$1,000 maximum)

Covered: Gas, water, drain, vent and waste lines within the perimeter of the main foundation; electric or

gas water heaters, tankless water heaters, plumbing fixtures; faucets; toilet tank, bowl and

internal components.

Not Covered: Any plumbing outside the perimeter of the main foundation or contained in or under the main

foundation or concrete slab, or wrapped in asbestos; conditions of excessive or insufficient

NPI

Property Inspector Pros DBA

National Property Inspections

Sample

water pressure; water quality; holding tanks; solar hot water systems; septic tank systems; sewage ejector pumps; sewer and water laterals; wells; any condition caused by rust, corrosion or chemical deposits; galvanized pipes; solar systems; jet and sump pumps; pressure tanks; holding tanks; shower stalls, enclosures, doors and base pans; caulking or grouting; hot tubs; whirlpools and spas and their mechanical components including electrical components; repairs of walls, floors, or ceilings when plumbing repairs are made; sprinkler systems; any pre-existing condition.

AIR CONDITIONING: (primary system only) (\$1,000 maximum)

Covered: Central air conditioning system using ductwork for the distribution of air; condensers;

compressors; thermostats; condenser fan motors; blower fan motors; interior refrigerant

lines; accessible ductwork.

Not Covered: Window, wall, gas, or portable air condition units; electronic air cleaners; dehumidifiers,

deionizers; ductwork that is concrete encased or otherwise inaccessible; registers; filters; grill guards or condenser housings; exterior refrigerant lines; any condition caused by rust or

corrosion; any pre-existing condition.

CENTRAL HEATING: (primary system only) (\$1,000 maximum)

Covered: Central forced air, gravity, heat pump systems; hot water boiler systems; electric baseboard

heat, if it is the only source of heat; built-in humidifiers; accessible ductwork and piping.

Not Covered: Steam boiler systems; heat exchanger; ductwork or steam or radiant heating coils or lines that

are wrapped in asbestos, encased in concrete or otherwise inaccessible; ceiling, wall or floor radiant heating systems; dehumidifiers, wood burning stoves; individual space heaters; outside fuel storage tanks and lines; electronic air filters; registers; filters; solar heating systems; fireplaces; fireplace inserts and components of any kind; any condition caused by rust or

corrosion; any pre-existing condition.

APPLIANCES: (\$500 maximum)

Covered: Primary refrigerator; oven; range; garbage disposal; dishwasher; built-in micro-wave; range exhaust

fan.

Not Covered: Individual freezer; washer; dryer; compactor; timers or clocks; rotisseries; meat probes; removable

racks or baskets; lock or key assemblies; ice makers; filters; gaskets; scratches, marring or dents; self-cleaning components of oven; any condition caused by rust or corrosion; any pre-existing

condition.

VI. Cancellation:

NPI may cancel this warranty for any fraud or misrepresentation on the part of the client.

VII. Additional exclusions and conditions:

A. **Excluded From Protection Under This Limited Warranty** is any item in the report which is said to be deficient, faulty, inoperable, in need of repair or in any way impaired, of suspect utility, at or beyond its normal life expectancy, or specifically excluded, as well as any item identified as not inspected or not tested, as indicated by any words or phrases which, by reasonable interpretation, would communicate any of the foregoing.

Also Excluded From Protection is any item, device, component, element, part or class of items at, in, on, or pertinent to the subject property premises which are inaccessible, concealed or a latent defect and which is not included in or specifically mentioned in the report.

NPI

Property Inspector Pros DBA

National Property Inspections

Sample

B. Since each item or system in a house has a normal life expectancy, this warranty will pay for repair, or replacement on a prorated basis.

DEFINITIONS:

- Mechanical Failure: Condition which causes a covered item or system to stop performing its designed function.
- Inaccessible: That which cannot be readily accessed for inspection due to design and/or obstacles, such as permanent partitions, chimney, etc.
- 3. **Service:** Repair or replacement of non-functioning covered item.
- 4. **<u>Pre-Existing Condition:</u>** Condition which caused a covered item to fail, which after prudent investigation, is determined to have existed prior to this warranty's effective date.
- 5. <u>Consequential Damage</u> Condition which results from any cause other than the direct mechanical failure of that item or system.
- 6. <u>Building Code or Zoning Violations:</u> Condition which does not meet building code specifications or zoning board requirements.
- 7. Concealed or Latent Defect: A deficient condition which is not visible or not readily accessible.